

ECR60X2 User Manual



Contents

1	Drive Description	4
1.1	Product Introduction.....	4
1.1.1	Characteristics.....	4
1.1.2	Electrical Characteristics.....	4
1.2	Power Supply & Motor	5
1.3	Digital Input and Output Ports	6
1.3.1	Digital Input Ports	6
1.3.2	Digital Output Ports	7
1.4	Connect EtherCAT.....	8
1.4.1	EtherCAT Status Indicator	8
1.5	EtherCAT Site Address	9
1.6	Alarm Code.....	9
1.7	Mechanical Dimensions.....	10
2	Parameter Description and Settings	11
2.1	General Parameters	11
2.1.1	0x1000 Type of Device.....	11
2.1.2	0x1009 Hardware Version.....	11
2.1.3	0x100A Software Version.....	11
2.1.4	0x1010 Save Parameters.....	11
2.1.5	0x1011 Restore Factory Settings.....	11
2.2	Manufacturer-specific Object.....	12
2.2.1	0x2000 Operating Current.....	12
2.2.2	0x2001 Subdivision/resolution	12
2.2.3	0x2002 Standby Time	12
2.2.4	0x2003 Percentage of Standby Current.....	12
2.2.5	0x2005 0x2805 Output Port Function	13
2.2.6	0x2006 0x2806 Output Port Polarity	13
2.2.7	0x2007 0x2807 Input Port Function	14

2.2.8	0x2008 0x2808 Input Port Polarity	15
2.2.9	0x2009 0x2809 Filter Time.....	15
2.2.10	0x200A Shaft Lock Time	15
2.2.11	0x200B Current Loop Parameters	15
2.2.12	0x200C Motor Parameters	16
2.2.13	0x200D Run Reverses	17
2.2.14	0x200E Internal Alarm Code	17
2.2.15	0x200F Internal Status Code	17
2.2.16	0x2010 Position Cleared	18
2.2.17	0x2011 Control Mode	18
2.2.18	0x2043 Speed Given.....	18
2.2.19	0x2044 Speed Feedback	18
2.2.20	0x2048 Voltage	18
2.2.21	0x2049 Input Level	19
2.2.22	0x204A Output Level.....	19
2.3	CIA402 Object Dictionary	19
2.3.1	0x603F Fault Code	19
2.3.2	0x6040 Control words	20
2.3.3	0x6041 Status Word.....	22
2.3.4	0x6060 Operation Mode.....	22
2.3.5	0x6061 Operation Mode Display.....	23
2.3.6	0x6064 Actual Position.....	23
2.3.7	0x606C Actual Speed.....	23
2.3.8	0x607A Target Position	23
2.3.9	0x607C Home Offset.....	23
2.3.10	0x6081 Track Speed	23
2.3.11	0x6083 Track Acceleration.....	24
2.3.12	0x6084 Track Deceleration	24
2.3.13	0x6085 Quickstop Declaration	24
2.3.14	0x6098 Homing Method	24

2.3.15	0x6099 Homing Speed.....	24
2.3.16	0x609A Homing Acceleration.....	25
2.3.17	0x60B8 Probe Function Setting	25
2.3.18	0x60B9 Probe Status	26
2.3.19	0x60BA Probe 1 Positive Latch Value	26
2.3.20	0x60BB Probe 1 Negative Latch Value.....	26
2.3.21	0x60BC Probe 2 Positive Latch Value	27
2.3.22	0x60BD Probe 2 Negative Latch Value	27
2.3.23	0x60FD Digital Inputs.....	27
2.3.24	0x60FE Digital Outputs	28
2.3.25	0x60FF PV Mode Speed Setting.....	28
2.3.26	0x6502 Operation Mode Supported	28
2.4	CIA402 Motion Control	29
2.4.1	Operation Mode.....	29
2.4.2	PP Profile Position Mode	29
2.4.3	PV Profile Velocity Mode.....	31
2.4.4	CSP Cyclic Sync Position Mode	33
2.4.5	Probe Function	33
2.4.6	Homing Mode	35

1 Drive Description

1.1 Product Introduction

The ECR60X2 is a 2-axis EtherCAT bus-controlled stepper motor drive with CoE (CANopen over EtherCAT) support.

1.1.1 Characteristics

- ◆ Support CoE (CANopen over EtherCAT), meet CiA 402 standards
- ◆ Support CSP, PP, PV, Homing mode
- ◆ The minimum synchronization period is 500us
- ◆ Dual port RJ45 connector for EtherCAT communication
- ◆ Motor type: two phase, three phase
- ◆ USB debugging interface :Modbus protocol
- ◆ Digital IO port:

8 channels photoelectric isolated digital signal input;

4 channels photoelectric isolated digital signal output.

1.1.2 Electrical Characteristics

ECR60X2 product specifications:


Product model	ECR60X2
Output current (A)	0.5~6A
Default current (mA)	3000
Power supply voltage	24~80VDC
Matched motor	Below 60 base
Photoelectric isolated input	24V input for 8 common anodes8
Photoelectric isolated output	4 photoelectric isolated output: alarm, brake, in-place and general output
Communication interface	Dual RJ45, with communication LED indication

- ◆ Please do not exceed the Range of use specified above.


1.2 Power Supply & Motor

Model	Description
ECR60X2	
V+	The power supply is DC, with V+ connected to the positive pole of the power supply and V- connected to the negative pole of the power supply. The recommended power supply voltage is 24~80VDC.
V-	
A1+	Motor 1 interface, when matched with a two-phase stepper motor, please connect two pairs of windings according to the motor wiring instructions. When matching a three-phase stepper motor, connect the U, V, and W windings to A1+, A1-, and B1+ respectively.
A1-	
B1+	
B1-	
A2+	Motor 2 interface, when matched with a two-phase stepper motor, please connect two pairs of windings according to the motor wiring instructions. When matching a three-phase stepper motor, connect the U, V, and W windings to A1+, A1-, and B1+ respectively.
A2-	
B2+	
B2-	

1. Two-phase stepper motor wiring

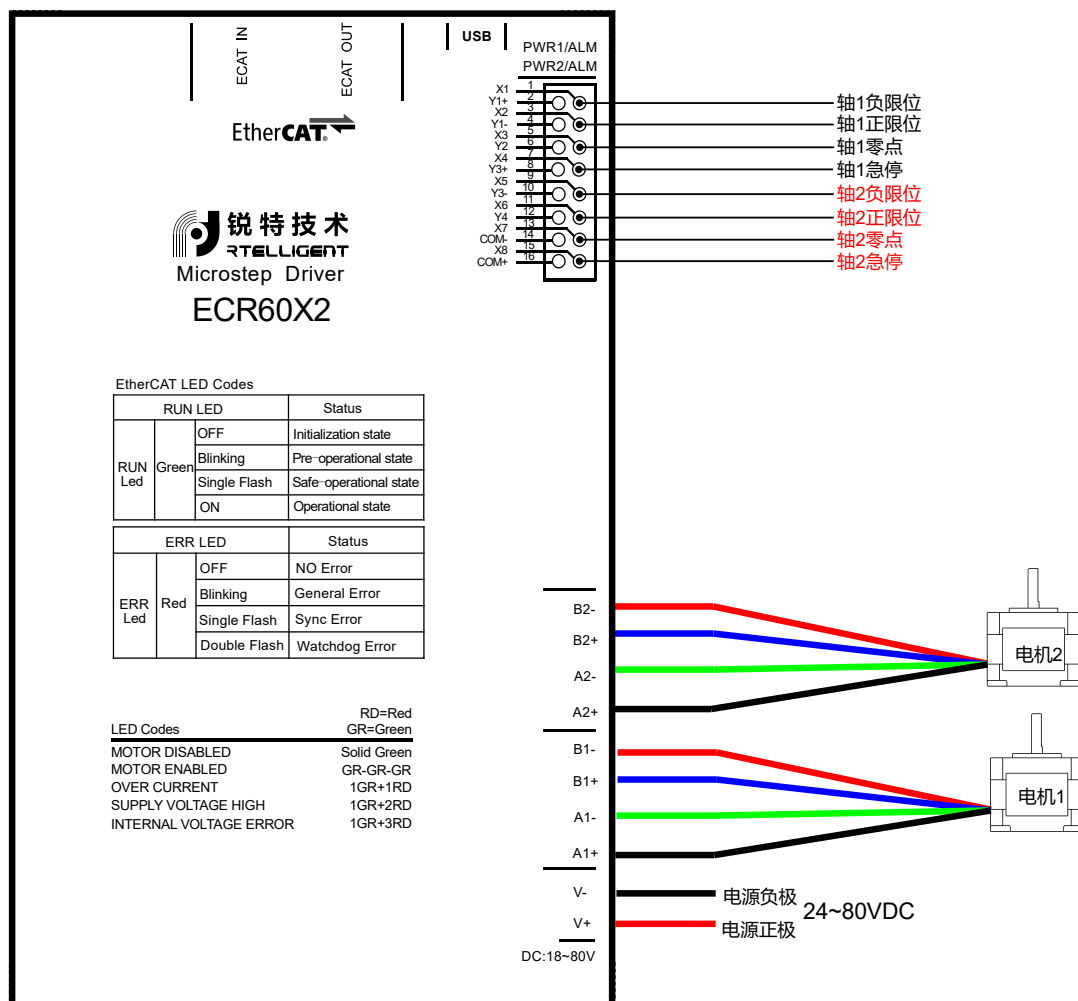

2. Three-phase stepper motor wiring

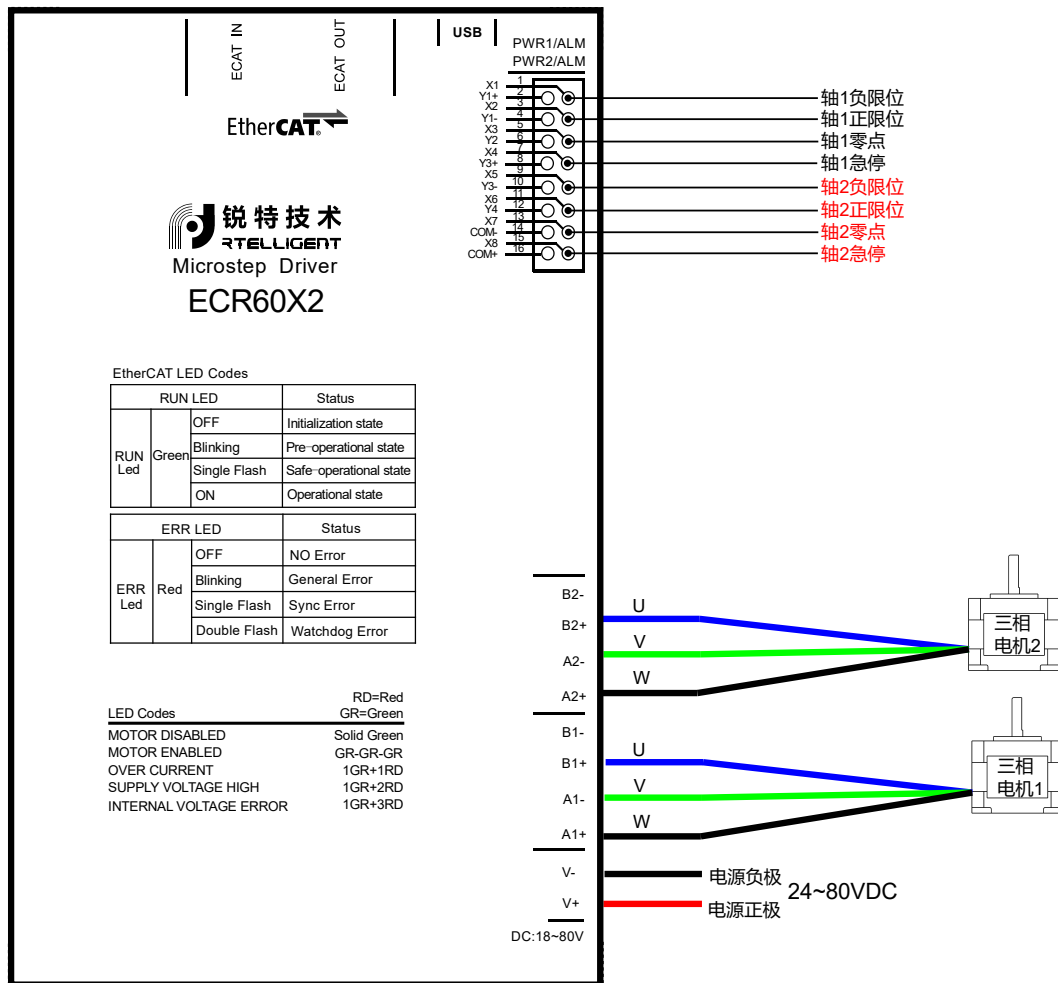

1.3 Digital Input and Output Ports

The ECR60X2 contains 8 input ports, common anode input, and 4 output ports.

1.3.1 Digital Input Ports


The 8-channel digital input port X1 to X8 of the ECR60X2 stepper drive is allocated to the use of two axes. X1 to X4 are used for axis 1 and X5 to X8 for axis 2.

Axis 1 sets the input port function through 0x2007 and the polarity of the input port through 0x2008.

Axis 2 sets the input port function through 0x2807 and the polarity of the input port through 0x2808.

Taking X1 as an example, the X2~X8 interface circuit is the same. The schematic diagram of the input port is shown below:

COM+ is connected to 24V:

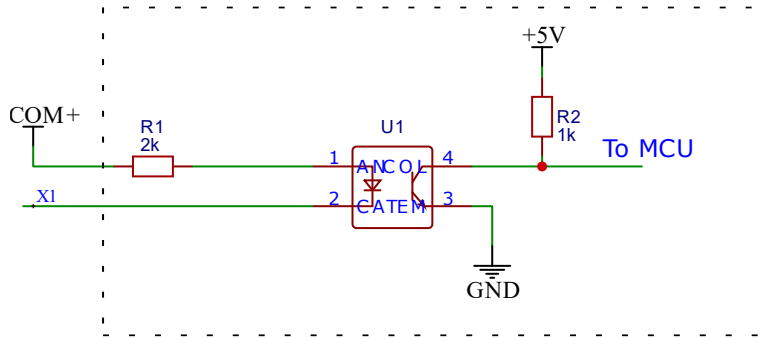

◆ Note: PNP input is not supported.


1.3.2 Digital Output Ports

The ECR60X2 series includes 4 photoelectric isolated output signals. The output current capacity up to 100mA. Assign to two axes for use.

The function of selecting output ports can be achieved through object dictionaries 0x2005 and 0x2805, while object dictionaries 0x2006 and 0x2806 are used to set the polarity of output ports.

Object Dictionary	Name	Property	Type	Range	Default	Remarks
0x2005: 01	Output port 1 function	R/W/S	UINT	0~3	1	Output port function selection: 0: Custom output 1: Alarm output 2: Brake output 3: In-place output
0x2005: 02	Output port 2 function	R/W/S	UINT	0~3	2	
0x2805: 01	Output port 3 function	R/W/S	UINT	0~3	1	
0x2805:02	Output port 4 function	R/W/S	UINT	0~3	2	Set the normally open and normally closed characteristics of the output port: 0: Normally closed 1: Normally open
0x2006	Output port polarity setting	R/W/S	UINT	0~3	3	

The circuit principle of the output port is as follows:

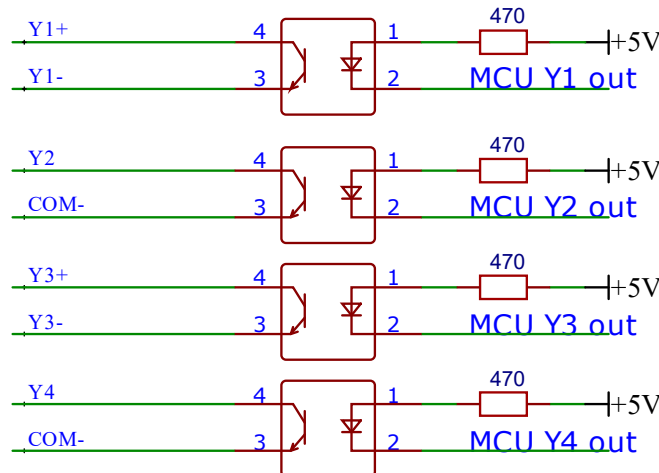

1.4 Connect EtherCAT


Please use CAT5E (or higher level) network cable.

The Ethernet input interface IN is connected to the Ethernet output interface OUT of the previous drive on the controller or the bus. The Ethernet output interface OUT is connected to the Ethernet input interface IN of the next drive on the bus. If the drive is the last node on the bus, you only need to connect the Ethernet input interface IN.

1.4.1 EtherCAT Status Indicator

The yellow light of RJ45 is used for Link status, indicating whether there is a network cable connection.

The green light of RJ45 is used for Activity state, indicating whether there is data communication.

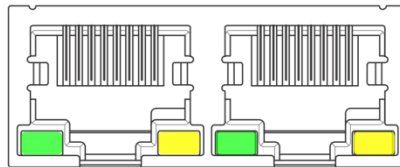

RUN/ERR LED indicator:

LED	Color	Status	Description
RUN	Green	Not bright	initialization status
		Slow Flash	pre-operational status
		Single flash	safe-operational status
		Always bright	operational status
ERR	Red	Not bright	No error
		Slow Flash	General error
		Single flash	Synchronization error
		Double flash	Watchdog error

Fast flash: bright for 50ms, dark for 50ms (10Hz). Repeat this cycle.

Slow flash: bright for 200ms, dark for 200ms (2.5Hz). Repeat this cycle.

Single flash: 200ms bright, 1s dark. Repeat this cycle.

Double flash: bright for 200ms, dark for 200ms, bright for 200ms, dark for 1s. Repeat this cycle.

1.5 EtherCAT Site Address

The ECR60X2 supports two methods to set the slave address: object dictionary 0x2150 to set the site alias and ESC to set the site alias, and select through the object dictionary 0x2151.

The default 0x2151 is 0, and the node address is allocated by the master station and saved in the EEPROM.


When users need to set their own fixed address, they need to set 0x2151 to 1, and then write the required address value in 0x2150.

0x2151	0x2150	Site address
0	1001	Master station configures site aliases to ESC EEPROM 0x0004 word addresses
1	Set value	Object dictionary 2150 sets the value to the node address value

1.6 Alarm Code

LED status		Drive status
	Green light on constantly	Drive not enabled
	Green light flashing	The drive works fine
	1 Green, 1 Red	Drive overcurrent
	1 Green, 2 Red	Drive input power overvoltage
	1 Green, 3 Red	Drive internal voltage error
	1 Green, 4 Red	Encoder out of tolerance alarm
	1 Green, 6 Red	Parameter check error

1.7 Mechanical Dimensions

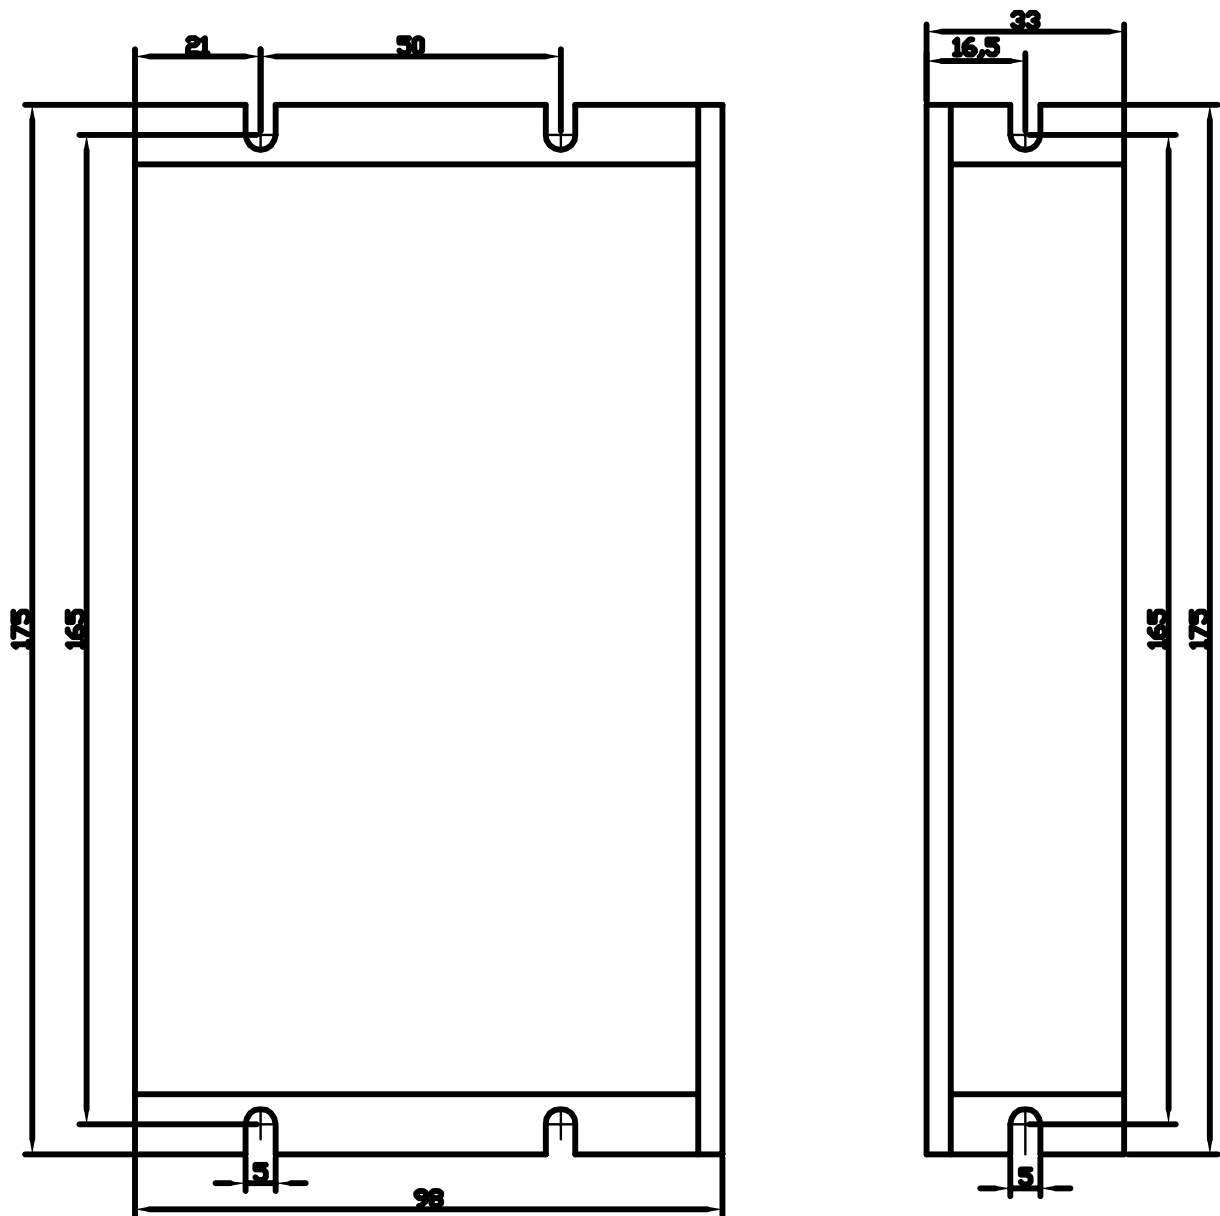

ECR60X2 installation dimensions

2 Parameter Description and Settings

2.1 General Parameters

2.1.1 0x1000 Type of Device

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED32	RO	NO	0x00040192

Bit 0~15: Device profile number 0x0192: CiA402

Bit 16~31: Additional information 0x0004: Stepper Drive

2.1.2 0x1009 Hardware Version

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	Visible string	RO	NO	0x30

2.1.3 0x100A Software Version

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	Visible string	RO	NO	0x303D

2.1.4 0x1010 Save Parameters

Sub-index of object dictionary 0x1010: 01 Write 1 to save current parameters.

When saving the parameters, first stop the motor running, then save the parameters.

The data structure is as follows:

Index	Sub-index	Name	PDO mapping	Default
1010	00	Maximum number of sub-indexes	No	1
	01	Save parameters	No	0

2.1.5 0x1011 Restore Factory Settings

Sub-index of object dictionary 0x1011: 01 Write 1, and then power on again to restore the drive to the factory state.

When restoring the factory setting, first stop the motor running, then save the parameters.

Index	Sub-index	Name	PDO mapping	Default
1011	00	Maximum number of sub-indexes	No	1
	01	Save parameters	No	0

2.2 Manufacturer-specific Object

Vendor object address of axis 2 = vendor object address of axis 1 + 0x800;

For example, 0x2000 is used to set the current of axis 1 motor and 0x2800 is used to set the current of axis 2 motor.

2.2.1 0x2000 Operating Current

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2000	Peak Current	R/W/S	UINT	100~6000	3000	mA

This object is used to set the sinusoidal peak current when the stepper motor is running in open loop.

2.2.2 0x2001 Subdivision/resolution

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2001	Motor Resolution	R/W/S	UINT	200~65535	10000	Pulse/rev

This object is used to set the number of pulses required to run the motor for one revolution when the stepper motor is running in open loop.

2.2.3 0x2002 Standby Time

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2002	Idle Time	R/W/S	UINT	200~65535	500	ms

This object is used to set the time to enter the standby state after the motor stops running when the stepping motor is open loop.

2.2.4 0x2003 Percentage of Standby Current

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2003	Idle Current Percent	R/W/S	UINT	0~100	50	%

This object is used to set the percentage of the current relative to the operating current set at 0x2000 when the stepping motor is open-loop running and the motor stops running into standby state.

2.2.5 0x2005 0x2805 Output Port Function

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2005:01	Output 1 Function	R/W/S	UINT	0~3	1	---
0x2005:02	Output 2 Function	R/W/S	UINT	0~3	2	---
0x2805:01	Output 3 Function	R/W/S	UINT	0~3	1	---
0x2805:02	Output 4 Function	R/W/S	UINT	0~3	2	---

ECR60X2 contains four output ports, which are used to set the function corresponding to the output port. OUT1 and OUT2 are used for axis 1, and OUT3 and OUT4 are used for axis 2.

The port function is defined as follows:

Value	Function
0	Custom output
1	Alarm output
2	Brake output
3	In place output

When set as a custom output, the state of the port can be controlled by the polarity setting of 0x2006.

2.2.6 0x2006 0x2806 Output Port Polarity

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2006	Outputs 1, 2 Polarity	R/W/S	UINT	0~3	3	---
0x2806	Outputs 3, 4 Polarity	R/W/S	UINT	0~3	3	---

Set the normally open and normally closed characteristics of the output port: Bit0 is the polarity setting for output port 1, Bit1 is the polarity setting for output port 2.

0—— Normally closed

1—— Normally open

Bit15~bit2	Bit1	Bit0
---	OUT2	OUT1

2.2.7 0x2007 0x2807 Input Port Function

The ECR60X2 contains 8 input ports, each axis is assigned 4 input ports, 0x2007, 0x2008 are used to set the axis 1, axis 2 input port corresponding function.

Axis 1 input port function setting:

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2007:01	Input 1 Function	R/W/S	UINT	0~8	1	---
0x2007:02	Input 2 Function	R/W/S	UINT	0~8	2	---
0x2007:03	Input 3 Function	R/W/S	UINT	0~8	3	---
0x2007:04	Input 4 Function	R/W/S	UINT	0~8	6	---

Axis 2 input port function setting:

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2807:01	Input 5 Function	R/W/S	UINT	0~8	1	---
0x2807:02	Input 6 Function	R/W/S	UINT	0~8	2	---
0x2807:03	Input 7 Function	R/W/S	UINT	0~8	3	---
0x2807:04	Input 8 Function	R/W/S	UINT	0~8	6	---

Value	Function
0	General input port
1	CW limit input
2	CCW limit input
3	HOME input
4	Fault clearance
5	Emergency stop signal
6	Motor offline
7	Probe 1
8	Probe 2

The status of the input port can be read by objects 0x60FD and 0x68FD.

The polarity of the input port can be set by objects 0x2008 and 0x2808.

2.2.8 0x2008 0x2808 Input Port Polarity

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2008	Inputs 1, 2 Polarity	R/W/S	UINT	0~3 F	x3F 0	---

Each bit defines the polarity of the corresponding port. Bit 0 defines the polarity of input port 1:

Bit15~Bit4	Bit3	Bit2	Bit1	Bit0
---	IN 4	IN 3	IN 2	IN1

0——Normally closed, 1——Normally open

2.2.9 0x2009 0x2809 Filter Time

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2009	Filter Time	R/W/S	UINT	0~25600	6400	us

The ECR60X2 has a built-in sliding average filter, and this object is used to set the time of the sliding average filter. The larger the filter time, the smoother the motor starts and stops, but the greater the motor response lag.

Lag time = filter time

2.2.10 0x200A Shaft Lock Time

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2009	Soft lock Time	R/W/S	UINT	0~65535	1000	50 us

When ECR60X2 is enabled, the stepper motor needs to be locked for initial positioning. In order to reduce the jitter of initial positioning, ECR60X2 has a built-in ramp-locking function. This object is used to set the ramp time of the motor shaft lock when the motor is enabled.

Shaft lock time = set value*50us*2 = set value*100us

2.2.11 0x200B Current Loop Parameters

Object Dictionary	Name	Property	Type	Range	Default	Remarks
0x200B:01	AutPI enable	R/W/S	UINT	0~1	1	The drive identifies the motor parameters while positioning for the first time and automatically calculates the PI gain 0--disable; 1--enable

0x200B:02	lloop_Kp	R/W/S	UINT	100~65535	1000	0x200B: When 01 is 1, this register cannot be set. When it is 0, users can set
0x200B:03	lloop_Ki	R/W/S	UINT	0~10000	200	
0x200B:04	lloop_Kc	R/W/S	UINT	0~1024	256	Anti-integral saturation coefficient.

ECR60X2 uses current control to achieve subdivision operation of stepper motors. ECR60X2 adopts automatic parameter recognition algorithm by default to recognize the electrical parameters of the motor and automatically calculate the appropriate current loop PI parameters. When the automatically identified PI parameters cannot meet the requirements, users can set the parameters by themselves.

2.2.12 0x200C Motor Parameters

Object Dictionary	Name	Property	Type	Range	Default	Remarks
0x200C:01	Motor, type	R/W/S	UINT	0~1	0	0——Two-phase stepper motor 1——Three-phase stepper motor, reserved function, current version is not available
0x200C:02	Resistance Auto	R	UINT	100~65535	1000	When automatic PI is turned on, the motor winding resistance value is recognized. Unit: mOhm
0x200C:03	Inductance Auto	R	UINT	0~10	1	When automatic PI is turned on, the motor winding inductance value is recognized. Unit: mH
0x200C:04	Resistance Set	R/W/S	UINT	0~10000	1000	Motor winding resistance value Unit: mOhm
0x200C:05	Inductance Set	R/W/S	UINT	1~10	1	Motor winding inductance value Unit: mH
0x200C:06	BEMF coefficient	R/W/S	UINT	0~1000	256	ECR60X2

Users can check the self-identification resistance and inductance value of this object to determine whether the motor connection is normal.

2.2.13 0x200D Run Reverses

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x200D	Invert motor direction	R/W/S	UINT	0~1	0	---

If the forward direction of the motor is inconsistent with the system requirements, this object can reverse the direction of the motor without modifying the motor wiring.

2.2.14 0x200E Internal Alarm Code

Object Dictionary	Name	Property	Type	Default
0x200E	Alarm Code	R	UINT	0

This object displays the current fault code of the drive, and each bit of the object corresponds to an alarm status.

Alarm code	Alarm status
0x0001	Internal voltage error
0x0002	Overcurrent
0x0004	Overvoltage
0x0008	Reserved
0x0080	Position error is out of tolerance
Other	Reserved

When the above fault occurs, after the fault condition is eliminated, by writing 0x80 in the 0x6040 object, the fault codes of 0x603F and 0x200E will be cleared.

2.2.15 0x200F Internal Status Code

Object Dictionary	Name	Property	Type	Default
0x200F	Status Code	R	UINT	0

This object displays the current status code of the drive, and each bit of the object corresponds to a status.

Status code	Status
0x0001	Drive enables
0x0002	Drive has failed
0x0004	In place signal
0x0008	Motor running or stopped
0x0010	Homing completed or not
0x0020	Drive ready
Other	Reserved

2.2.16 0x2010 Position Cleared

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2010	Zero Position	R/W	UINT	0~1	0	---

Setting the object to 01h can clear the position value (position actual value) in 0x6064.

It is usually used when the motor is always moving in one direction. The user needs to stop the motor at an appropriate time, clear the actual position value through this object, and then enable the motor again. Otherwise, the motor position counter will be saturated.

2.2.17 0x2011 Control Mode

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2011	Control mode	R/W/S	UINT	0~2	0	---

Set the working mode of the stepper motor.

0——open loop

ECR60X2 can only work in open loop mode, setting other values is invalid.

2.2.18 0x2043 Speed Given

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2043	Speed Reference	R	UINT	-3000~3000	0	RPM

This object reflects the given speed of the current motor.

2.2.19 0x2044 Speed Feedback

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2044	Speed Feedback	R	UINT	-3000~3000	0	RPM

This object reflects the actual speed of the current motor.

ECR60X2 returns the actual speed, and the value returned by ECR60X2 = given speed.

2.2.20 0x2048 Voltage

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2048	Bus Voltage	R	UINT	---	0	10 mV

Bus voltage value (V)= object value/100.

2.2.21 0x2049 Input Level

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x2049	Input Level	R	UINT	---	0	---

Displays the physical level of the current IO input:

Bit15~bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
---	IN 6	IN 5	IN 4	IN 3	IN 2	IN1

0—No input signal

1—Input signal

2.2.22 0x204A Output Level

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x204A	Output Level	R	UINT	---	0	---

Displays the physical level of the current output port.

Bit15~bit2	Bit1	Bit0
---	OUT2	OUT1

0—Indicates that the current output port has an output

1—Indicates that the current output port has no output

2.3 CIA402 Object Dictionary

According to COE multi-axis specification, axis 2 object dictionary address = axis 1 object address + 0x800. This section is no longer listed separately. For example, 0x603F is the fault code of axis 1 and 0x683F is the fault code of axis 2.

2.3.1 0x603F Fault Code

Object Dictionary	Name	Property	Type	Range	Default
0x603F	Error Code	R W	UINT		0

When a fault occurs, first eliminate the fault condition, then write 0x0080 to the control word 0x6040 and clear 0x603F.

The fault code is as follows:

Error Code	Description
0x7500	Communication fail
0x3150	Phase A circuit internal voltage error
0x3151	Phase B circuit internal voltage error
0x8611	Closed-loop mode tracking error over limit
0x2211	Overcurrent
0x3110	Overvoltage

2.3.2 0x6040 Control words

This object is used to control the state of the drive and movement. Can enable/disable the drive; start and stop the motor; clear faults, etc.

Object Dictionary	Name	Property	Type	Range	Default
0x6040	Control Word	RW	UINT		0

The bits of the control word are defined as follows:

Bit	Description
0	Switch ON
1	Enable Voltage
2	Quick Stop
3	Enable Operation
4	Operation mode related
5	Operation mode related
6	Operation mode related
7	Fault reset
8	Pause
9	Operation mode related
10-15	Reserved

Detailed description of the combination of Bit 0~3 and Bit7:

Command	Control word bit				
	Bit 7	Bit 3	Bit 2	Bit 1	Bit0
Shutdown	0	x	1	1	0
Switch on	0	0	1	1	1
Switch on +Enable operation	0	1	1	1	1
Disable voltage	0	x	x	0	x
Quick stop	0	x	0	1	x
Disable Operation	0	0	1	1	1
Enable Operation	0	1	1	1	1
Fault reset	0->1	x	x	x	x

Definition of Bit4、5、6、8、9 in related modes:

PP mode:

Bit	Name	Value	Description
4	A new target location	0->1	Change from 0 to 1, set a new target location
5	Reserved		
6	Absolute/relative	0	Absolute position mode
		1	Relative position mode
8	Pause	0	The motor is waiting to be positioned.
		1	Stop running
9	Reserved		

PV mode:

Bit	Name	Value	Description
8	Pause/run	0	The motor runs to the set speed
		1	The motor decelerates to 0 and stops

Homing mode

Bit	Name	Value	Description
4	Start to Home	0->1	Start to Home
8	Pause	0	Controlled by bit4
		1	Stop homing

2.3.3 0x6041 Status Word

This object sets the probe function.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED16	RW	Yes	0

The register bits are defined as follows:

Bit	Description
0	Ready To Switch ON
1	Switch ON
2	Operation Enabled
3	Fault
4	Voltage Enabled
5	Quick Stop
6	Switch On Disabled
7	Warning
8	Reserved
9	Remote
10	Target arrival
11-15	Reserved

Bit 9: Remote. This bit indicates whether the Control word has been settled.

2.3.4 0x6060 Operation Mode

Used to set the operation mode.

Object Dictionary	Name	Property	Type	Range	Default
0x6060	Mode of Operation	RW	INTEGER8		0

The ECR60X2 drive supports the following modes of operation:

Value	Mode
1	Profile Position Mode (PP)
3	Profile Velocity Mode (PV)
6	Homing Mode (HM)
8	Cyclic Synchronous Position Mode (CSP)

2.3.5 0x6061 Operation Mode Display

Display the current operating mode, the definition is the same as 0x6060.

Object Dictionary	Name	Property	Type	Range	Default
0x6061	Mode of Operation Display	R	INTEGER8		0

2.3.6 0x6064 Actual Position

Display the actual position of the current motor, the unit is Pulse.

Object Dictionary	Name	Property	Type	Range	Default
0x6064	Position Actual Value	R	INTEGER 32		0

2.3.7 0x606C Actual Speed

Display the actual speed of the current motor. The unit is RPM

Object Dictionary	Name	Property	Type	Range	Default
0x606C	Position Actual Velocity	R	UNIT		0

2.3.8 0x607A Target Position

This object sets the target position in PP mode and CSP mode. The unit is Pulse.

Object Dictionary	Name	Property	Type	Range	Default
0x607A	Profile Target Position	RW	INTEGER 32		0

In PP mode, Bit6(0x6040.6) of the control word is used to set the coordinates to be relative.

In CSP mode, the target position is absolute position mode.

2.3.9 0x607C Home Offset

This object is used to set the offset of the home sensor and position 0. The unit is Pulse.

Object Dictionary	Name	Property	Type	Range	Default
0x607C	Home Offset	R W	INTEGER 32		0

2.3.10 0x6081 Track Speed

This object is used to set the maximum speed of the trapezoidal acceleration/deceleration command in PP mode. The unit is Pulse/s.

Object Dictionary	Name	Property	Type	Range	Default
0x6081	Profile Velocity	R W	INTEGER 32		10000

2.3.11 0x6083 Track Acceleration

This object is used to set the acceleration of the trapezoidal acceleration/deceleration command in PP mode and PV mode, the unit is Pulse/s².

Object Dictionary	Name	Property	Type	Range	Default
0x6083	Profile Acceleration	R W	INTEGER 32		100000

2.3.12 0x6084 Track Deceleration

This object is used to set the deceleration of the trapezoidal acceleration/deceleration command in PP mode and PV mode, the unit is Pulse/s².

Object Dictionary	Name	Property	Type	Range	Default
0x6084	Profile Deceleration	R W	INTEGER 32		100000

2.3.13 0x6085 Quickstop Declaration

This object is used to set the deceleration of the motor when it hits the limit, home and other sensors in PP mode, PV mode, and HOME mode. The unit is Pulse/s.

Object Dictionary	Name	Property	Type	Range	Default
0x6085	Quickstop Declaration	R W	INTEGER 32		500000

2.3.14 0x6098 Homing Method

This object is used to set the homing method for the motor.

Object Dictionary	Name	Property	Type	Range	Default
0x6098	Homing Method	R W	INTEGER8	17~35	17

For detailed description, please refer to homing mode.

2.3.15 0x6099 Homing Speed

This object sets the motor speed when in homing mode.

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x6099:01	Homing Velocity (fast)	R/W/S	UNSIGNED32	---	10000	Pulse/s
0x6099:02	Homing Velocity (slow)	R/W/S	UNSIGNED32	---	2000	Pulse/s

2.3.16 0x609A Homing Acceleration

This object is used to set the acceleration and deceleration of the position curve when in homing mode. The unit is Pulse/s².

Object Dictionary	Name	Property	Type	Range	Default
0x609A	Homing Acceleration	R W	UNSIGNED 32		100000

2.3.17 0x60B8 Probe Function Setting

This object sets the probe function.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED16	RW	Yes	0

The register bits are defined as follows:

Bit	Value	Definition
0	0	Probe 1 disabled
	1	Probe 1 enable
1		Reserved
2		Reserved
3		Reserved
4	0	Disable probe 1 falling edge latch
	1	Enable probe 1 rising edge latch
5	0	Disable probe 1 falling edge latch
	1	Enable probe 1 falling edge latch
6		Reserved
7		Reserved
8	0	Probe 2 disabled
	1	Probe 2 enable
9		Reserved
10		Reserved
11		Reserved
12	0	Disable probe 2 falling edge latch
	1	Enable probe 2 rising edge latch
13	0	Disable probe 2 falling edge latch
	1	Enable probe 2 falling edge latch
14		Reserved
15		Reserved

The positive position is latched at the rising edge, and the negative position is latched at the falling edge.

2.3.18 0x60B9 Probe Status

This object defines the status of the probe function.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED16	R	Yes	0

The status bits are defined as follows:

Bit	Value	Definition
0	0	Probe 1 disabled
	1	Probe 1 enable
1	0	Probe 1 rising edge latch: none
	1	Probe 1 rising edge latch: yes
2	0	Probe 1 falling edge latch: none
	1	Probe 1 falling edge latch: yes
3-7	0	Reserved
8	0	Probe 2 disabled
	1	Probe 2 enable
9	0	Probe 2 rising edge latch: none
	1	Probe 2 rising edge latch: yes
10	0	Probe 2 falling edge latch: none
	1	Probe 2 falling edge latch: yes
11-15	0	Reserved

2.3.19 0x60BA Probe 1 Positive Latch Value

This object holds the position latched by the rising edge of probe 1.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED 32	R	Yes	0

2.3.20 0x60BB Probe 1 Negative Latch Value

This object holds the position latched by the falling edge of probe 1.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED 32	R	Yes	0

2.3.21 0x60BC Probe 2 Positive Latch Value

This object holds the position latched by the rising edge of probe 2.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED 32	R	Yes	0

2.3.22 0x60BD Probe 2 Negative Latch Value

This object holds the position latched by the falling edge of probe 2.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED 32	R	Yes	0

2.3.23 0x60FD Digital Inputs

This object monitors the input port of the drive.

Object Type	Data Type	Access Type	PDO Mapping	Default Value
VAR	UNSIGNED32	RO	Yes	0x00000000

Bit0	CW limit	0——Invalid 1——Limit take effect
Bit1	CCW limit	
Bit2	HOME	0——HOME invalid 1——HOME invalid
Bit3~ Bit15	Reserved	
Bit16	IN1	Physical state of input port 0——Input signal is invalid 1——Input signal is valid
Bit17	IN2	
Bit18	IN3	
Bit19	IN4	
Bit20	IN5	
Bit21	IN6	
Bit22~Bit31	Reserved	

2.3.24 0x60FE Digital Outputs

This object controls the digital output signal.

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x60FE:01	physical outputs	R/W/S	UNSIGNED32	---	0	
0x60FE:02	bit mask	R/W/S	UNSIGNED32	---	0	

Physical outputs:

Bit 0~15 are reserved functions.

Bit 16~17 are used to control OUT1~OUT2.

Bit 18~31 are reserved functions.

0 and 1 correspond to output off and on

Bit mask:

Bit 0~15 are reserved functions.

Bit 16~17 are used to enable OUT1~OUT2.

Bit 18~31 are reserved functions.

0 and 1 control whether the output port is enabled or not. 0--not enabled, 1--enabled.

2.3.25 0x60FF PV Mode Speed Setting

This object sets the speed in PV mode, the unit is Pulse/s.

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x60FF	Target Velocity	RW	DINT		0	Pulse/s

This object is 32-bit signed data, and the positive and negative values respectively represent the two directions of motor operation.

2.3.26 0x6502 Operation Mode Supported

This object describes the operation mode supported by the drive.

Object Dictionary	Name	Property	Type	Range	Default	Unit
0x6052	Supported Drive Modes	R	UDINT		0x000000A5(165)	---

The bits are defined as follows:

Bit	Description
0	PP: Profile Position Mode
1	VI: Velocity Mode
2	PV: Profile Velocity Mode
3	TQ: Torque Profile Mode
4	Reserved
5	HM: Homing Mode
6	IP: Interpolated Position Mode
7	CSP: Cyclic Sync Position Mode
8	CSV: Cyclic Sync Velocity Mode
9	Cyclic Sync Torque Mode
10-31	Reserved

Bit value = 0: Not support

Bit value = 1: Support

The ECR60X2 stepper drive supports PP, PV, HM and CSP modes.

2.4 CIA402 Motion Control

2.4.1 Operation Mode

The ECR60X2 EtherCAT stepper drive supports the following operation modes (0x6060):

- ◆ Profile Position (PP)
- ◆ Profile Velocity (PV)
- ◆ Cyclic Synchronous Position (CSP)
- ◆ Homing (HM)

2.4.2 PP Profile Position Mode

Profile position mode description:

Standard position mode is a point-to-point operation mode that uses a set point composed of speed, acceleration, deceleration and target position. Once all these parameters are set, the drive will buffer these commands and start executing the set point.

Enable PP mode:

To enable the profile position mode, the value of the object dictionary 6060h (operation mode) must be set to 0001h. The object dictionary 6061h (operation mode display) can be used to confirm whether the drive has entered the correct operation mode.

Set operating parameters:

Use object dictionary 607Ah, 6081h, 6083h, 6084h to set position, velocity, acceleration, deceleration respectively.

Start and stop:

After power on, the drive is in the disabled state. Writing 0006h into the control word 6040h will make the drive enter the "ready to switch on" state.

By sending 001Fh to the object dictionary 6040h of the control word, to indicate a new set point and start movement.

To enable the operation of the drive, the value 001Fh must be written into the object dictionary address 6040h of the control word. This also means that a new set point is ready. The drive uses Bit12 of the status word (6041h) to indicate that a valid setpoint is received. Because the set point is edge triggered, once the drive receives and processes the set point, the control word must be cleared by writing 000FH to the control word register.

Controlword Bits:

New set point (bit 4) -- set this bit high to clock in a new set-point. Once the drive receives the set point, Bit12 of the status word will be set to high (1), and bit4 of the control word needs to be set to 0;

Setpoint Change (bit 9) -- If it is low, the drive enters an idle state after executing the current setpoint and waits for the next new setpoint. If it is high, the drive will run to the last set point at the last set speed, then switch to the new speed and run to the new set point.

Setpoint takes effect immediately (bit 5) -- If this bit is high, the new setpoint takes effect immediately and the motor will run to the new position at the speed of the new setpoint.


Absolute mode/relative mode (bit 6) -- If it is high, the set point is in relative position mode. For example, if the previous motor position is 10,000 steps, and the new set point is 20,000, the final position will be 30,000. If it is low, the set point is in absolute position mode. If the previous motor position is 10000 and the new set position is 20000, then the new position will be 20000. (The distance from the previous position to the new position is 10,000 steps). Do not change this position when the motor is moving.

2.4.3 PV Profile Velocity Mode

Profile velocity mode description:

The profile velocity is a relatively simple mode of operation. Once the speed, acceleration and deceleration are set, the drive will command the motor to accelerate to the running speed according to the acceleration parameter, or stop the movement according to the deceleration parameter.

The figure below shows an example of configuring the speed mode:

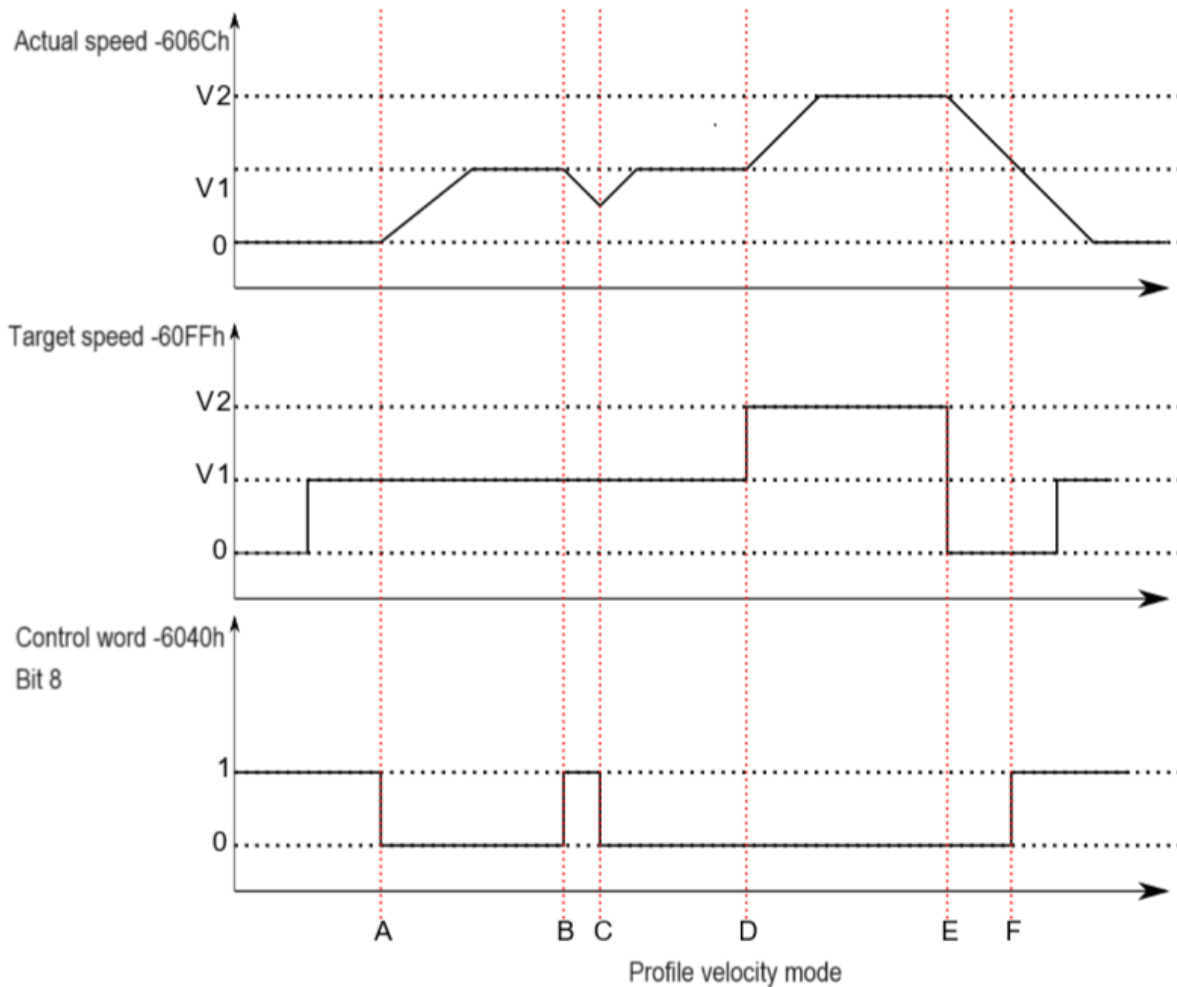

The above figure shows the corresponding relationship between the motor running status, actual speed, target speed and control word.

	Target speed	6040h stop bit Bit4	Motor movement status
Start	0	1	Motor stop
A	V1	1 -> 0	Motor accelerates to V1
B	V1	0 -> 1	Motor decelerates to stop
C	V1	1 -> 0	Before the motor stopped, it accelerated to V1.
D	V1 -> V2	0	Motor accelerates from V1 to V2
E	V2 -> 0	0	Motor decelerates from V2 to 0
F	0	0 -> 1	Motor stop
G	0 -> V1	1	Motor stop

The table above explains how the stop bit and the target speed are used together to affect motor speed. Between points B and C, the motor does not come to a complete stop, but decelerates according to the trajectory deceleration value that begins at point B. When the stop bit switches at point C, it immediately accelerates back to the target speed. At point E, reducing the target speed to zero has the same effect as using the stop bit.

It should be noted that no matter if the stop bit is set and the target speed is set to zero, a torque will be maintained on the motor. If you want the axis to move freely, the drive must be placed in the drive disabled (disabled) status.

Enable PV mode:

To enable the profile velocity mode, the value of object dictionary 6060h (operation mode) must be set to 0003h. The object dictionary 6061h (operation mode display) can be used to confirm whether the drive has entered the correct operation mode.

Set operating parameters:

Use object dictionary 60FFh, 6083h, 6084h to set the speed, acceleration and deceleration of the profile velocity mode respectively.

Enable drive:

After power on, the drive is in the disabled state. Writing 0006h into the control word 6040h will make the drive enter the "ready to switch on" state. Write 010Fh into 6040h to make the drive enter the "Operation Enabled" state, and the motor is stopped.

Start and stop:

To start and stop the movement, switch the control word stop bit (bit 8). When the stop bit is set to 0 (000Fh), the movement will start or continue; when the stop bit is set to 1 (010Fh), the movement will stop.

Profile velocity (60FFh) more than zero means the motor is running forward, less than zero means the motor is reversing, and equal to zero means the motor is stopped. Users can directly set the motor to enter the reverse state when the motor is running forward, and the motor will decelerate to stop and accelerate to the set speed in the reverse direction.

2.4.4 CSP Cyclic Sync Position Mode**Cyclic sync position mode description:**

In this mode, the main controller generates a position trajectory and sends the target position (0x607A) to the drive in each PDO update cycle. The driver feedbacks the actual motor position and optional actual motor speed and torque.

Enable CSP mode:

To enable the cyclic synchronization position mode, the value 0008h must be written to the dictionary address 6060h.

Enable drive:


After power on, the drive is in the disabled state. Writing 0006h into the control word 6040h will make the drive enter the "ready to switch on" state. Write the value 0x000F to 6040h again, the drive will be in the enabled state, and the motor can respond to the CSP command.

2.4.5 Probe Function

The probe function latches the motor position information through the digital input port. ECR60X2's digital input port function and polarity can be defined by 0x2007, 0x2008.

The relevant object dictionary of the probe function is as follows:

Index	Object description
0x60B8	Touch Probe Function
0x60B9	Touch Probe Status
0x60BA	Touch Probe Position 1 Positive Value
0x60BB	Touch Probe Position 1 Negative Value
0x60BC	Touch Probe Position 2 Positive Value
0x60BD	Touch Probe Position 2 Negative Value

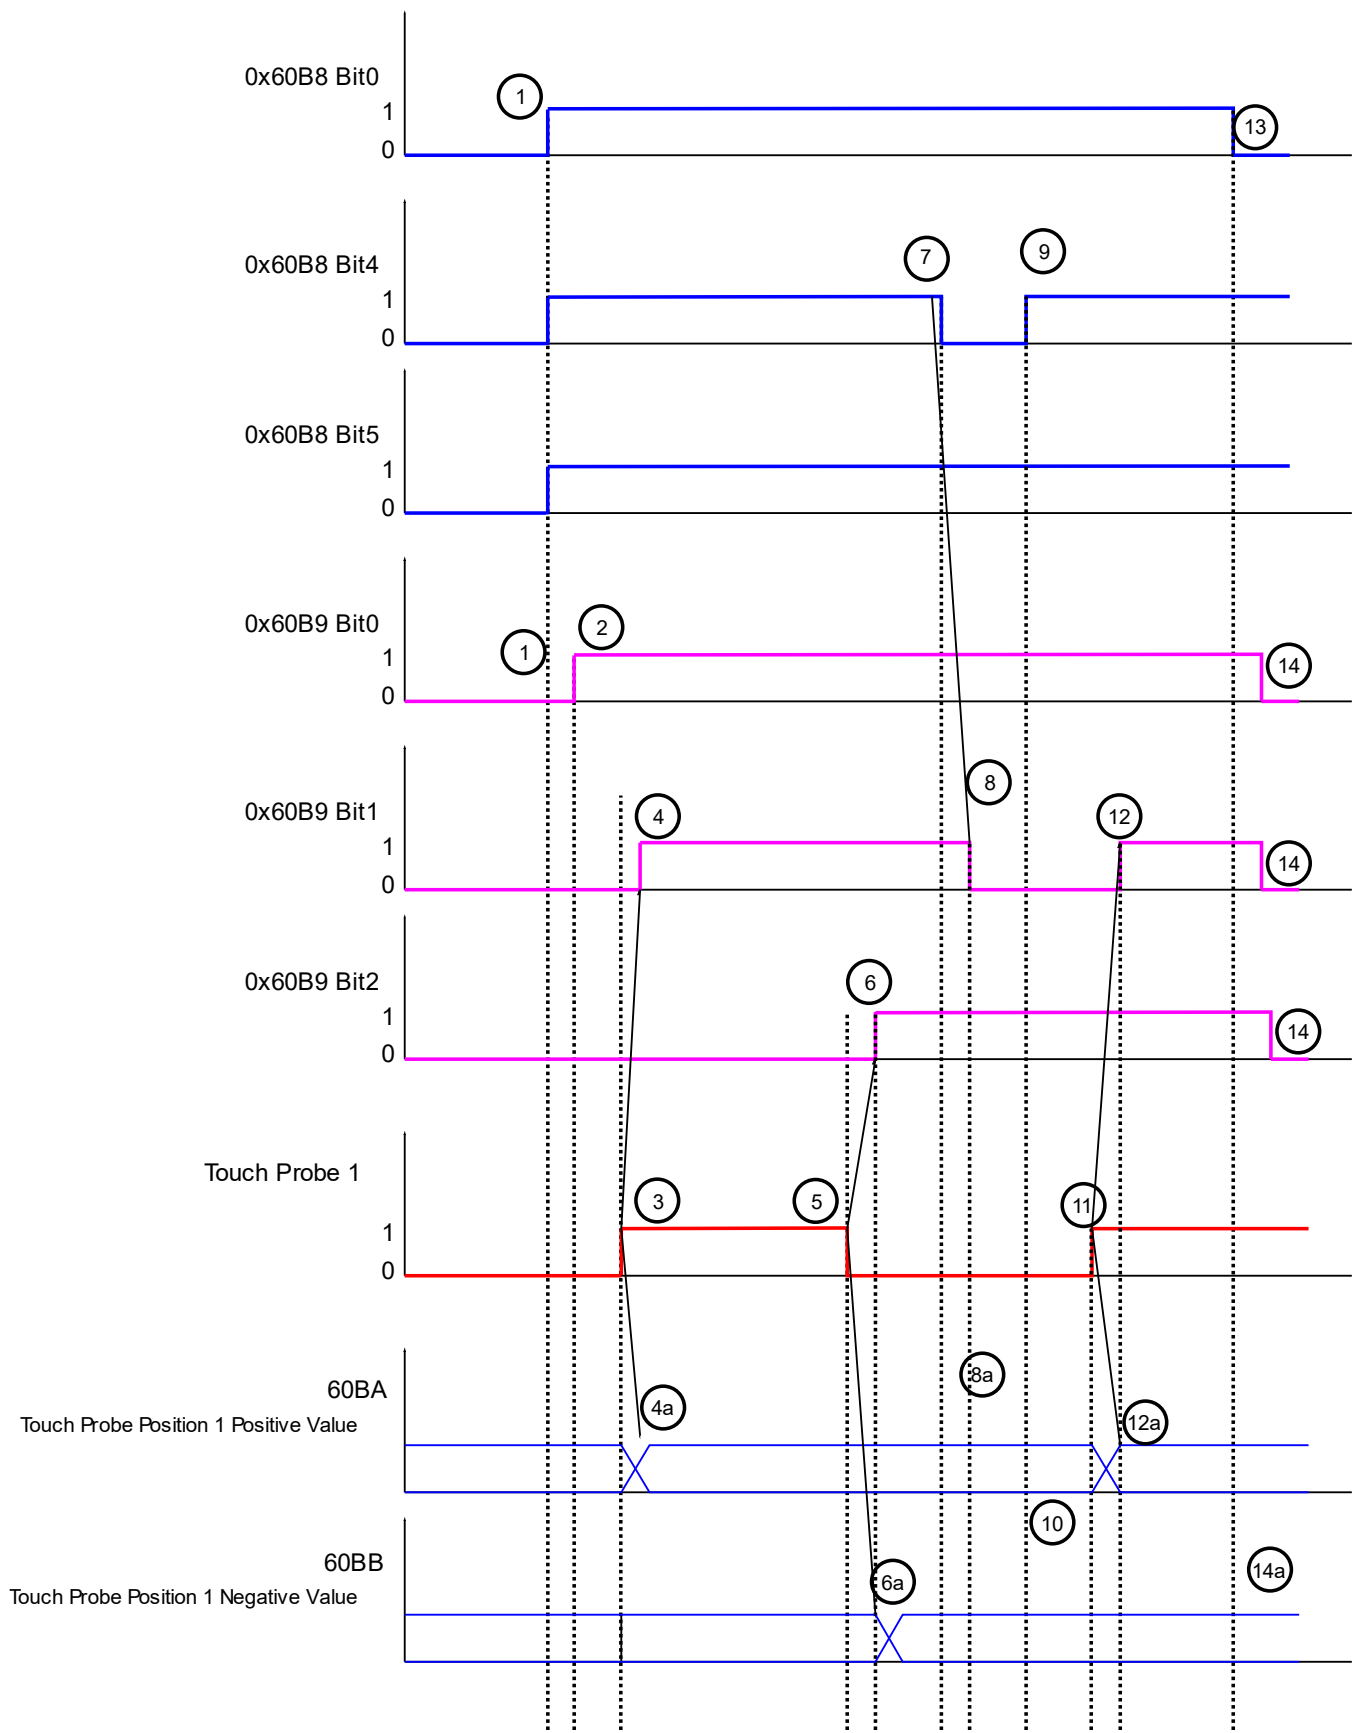

Probe timing diagram

Serial No.	Change of registers	Probe action
1	60B8 Bit 0 = 1 60B8 Bit 1,4,5	Enable probe 1 Configure the rising edge and falling edge of the enable probe
2	-> 60B9 Bit 0 = 1	The state "probe 1 enabled" is set
3	External probe signal rising edge	
4	-> 60B9 Bit 1 = 1	The state "Probe 1 rising edge latch" is set
4a	-> 60BA	The positive position of probe 1 is latched
5	External probe signal falling edge	
6	-> 60B9 Bit 2 = 1	The state "Probe 1 falling edge latch" is set
6a	-> 60BB	The negative position of probe 1 is latched
7	-> 60B8 Bit: 4	Rising edge latch function: disabled
8	-> 60B9 Bit 0 = 0	The state "Probe 1 rising edge latch" is cleared
8a	-> 60BA	Probe 1 positive position, the latch position remains unchanged
9	-> 60B8 Bit 4 = 1	Rising edge latch function: enable
10	-> 60BA	Probe 1 positive position, the latch position remains unchanged
11	External probe signal rising edge	
12	-> 60B9 Bit 1 = 1	The state "Probe 1 rising edge latch" is set
12a	-> 60BA	The positive position of probe 1 is latched
13	-> 60B8 Bit 0 = 0	Probe 1 function: disabled
14	-> 60B9 Bit 0,1,2 = 0	Status bit is cleared
14a	-> 60BA,60BB	No change in the positive/negative latch position of probe 1

Probe timing description

2.4.6 Homing Mode

Set homing parameters

Set the homing speed, acceleration, home offset and related sensor input signals.

The relevant object dictionary is as follows:

Object dictionary	Description
0x607C	Home offset
0x6098	Homing method setting
0x6099	Homing speed
0x609A	Homing acceleration
0x2007	Input port function selection
0x2008	Input port polarity setting

Enable homing mode:

To enable the zero return mode, the value of object dictionary 6060h (operation mode) must be set to 0006h. The object dictionary 6061h (operation mode display) can be used to confirm whether the drive has entered the correct operation mode.

After the drive is initially powered on, it is in the disabled state. Write 6 to the control word 6040h, set the drive to the "ready to switch on" state, then write 000Fh to the control word 6040h, and set the drive to "Operation Enabled Mode".

Active Homing function:

Set the homing method through the 6098h object dictionary.

Set the homing speed through 0x6099.

Through the Bit4 of the control word 6040h, the rising edge from 0 to 1, can start the function of homing.


The status of homing is queried through the 6041 status word.

Stop the homing function:


Set the homing method through the 6098h object dictionary. Through the Bit8 of the control word 6040h, the rising edge from 0 to 1, can stop the function of homing. The status of homing is queried through the 6041 status word.

1. Homing method


The ECR60X2 drive supports 17~37 homing methods. The specific definition and the process of homing are described as follows.

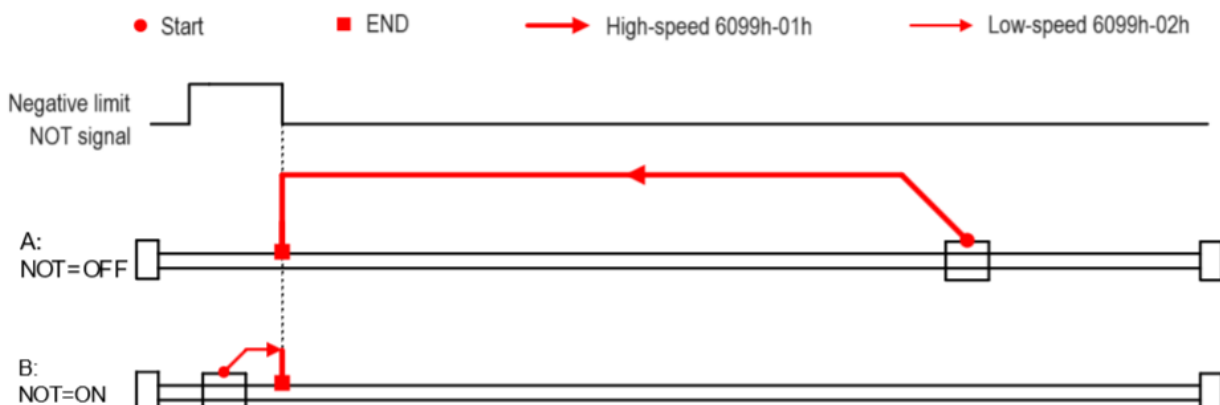(1) Method 17:


(2) Method 18:

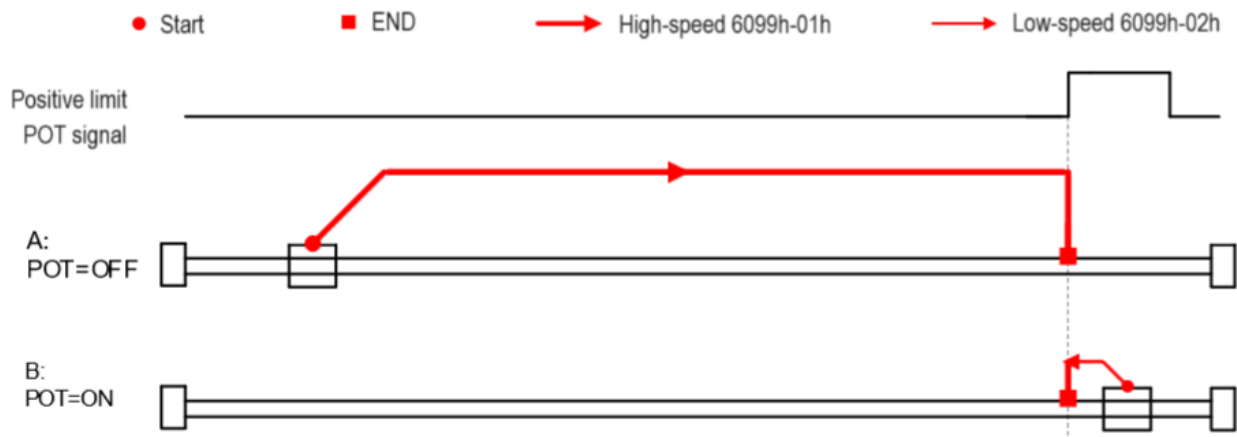


(3) Method 19:

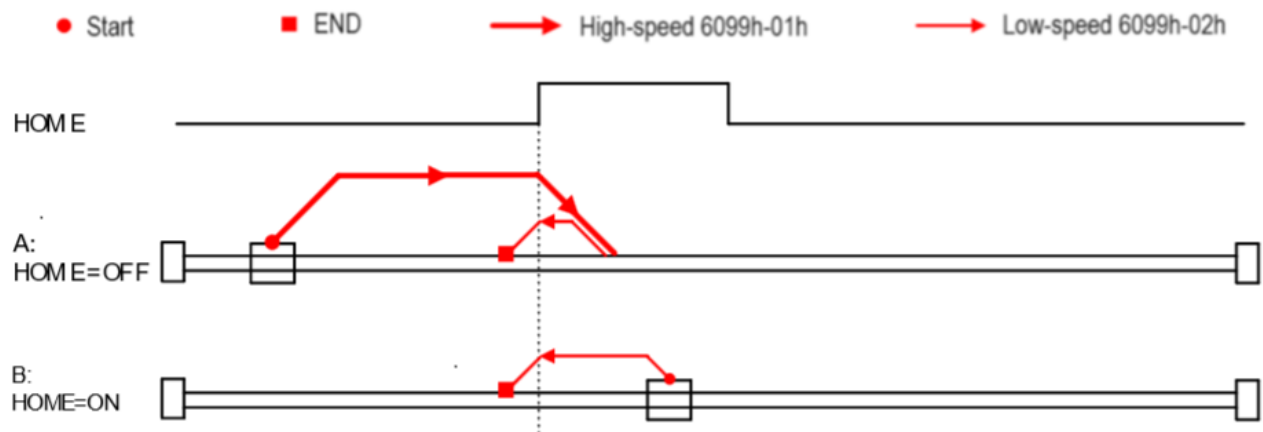


(4) Method 20:

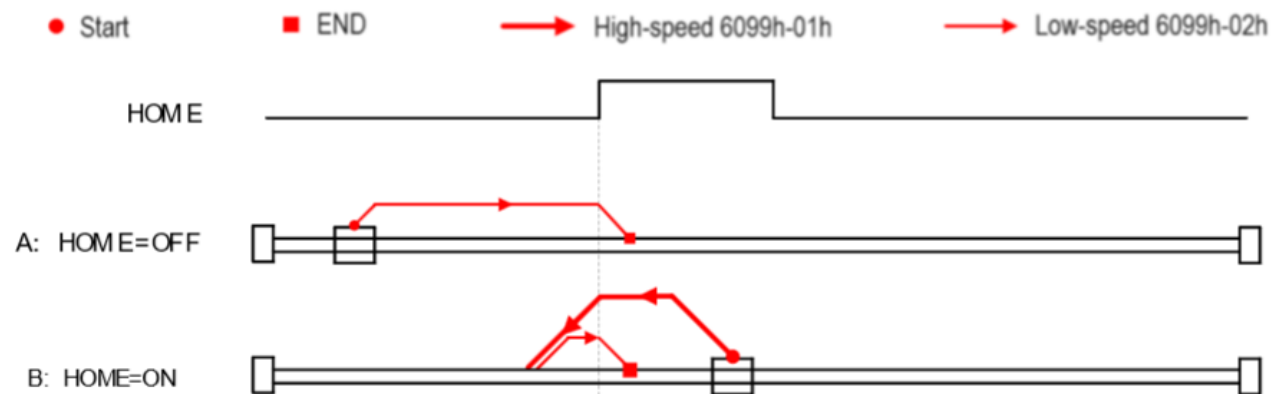


(5) Method 21:

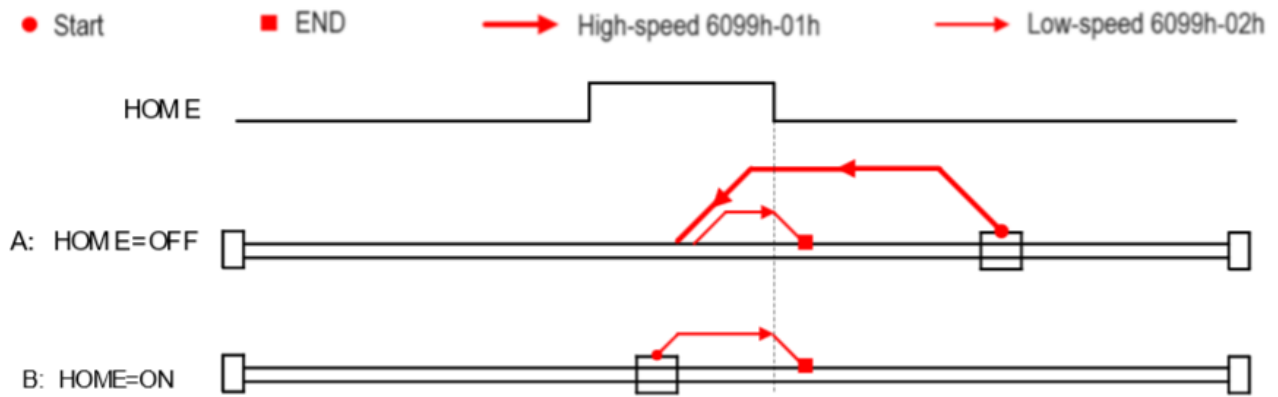


(6) Method 22:

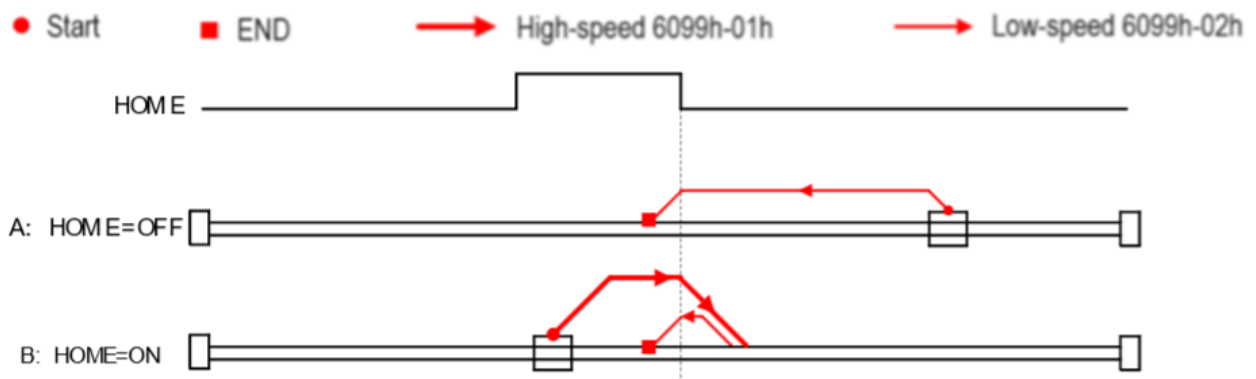


(7) Method 23:

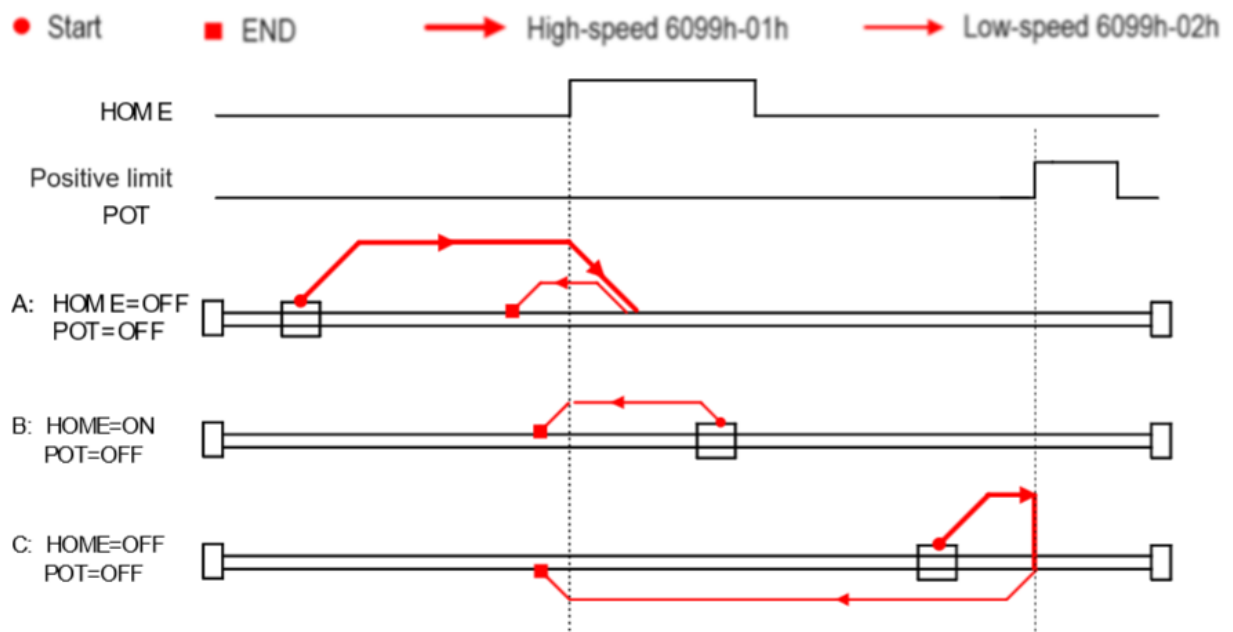


(8) Method 24:

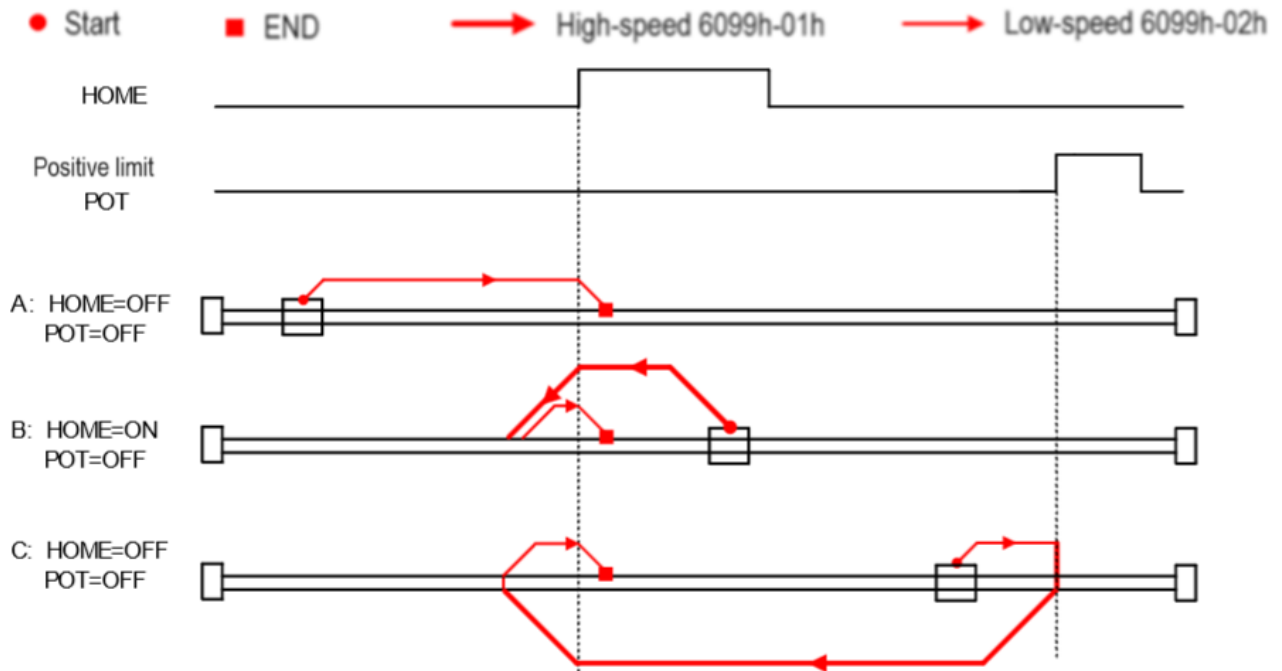


(9) Method 25:

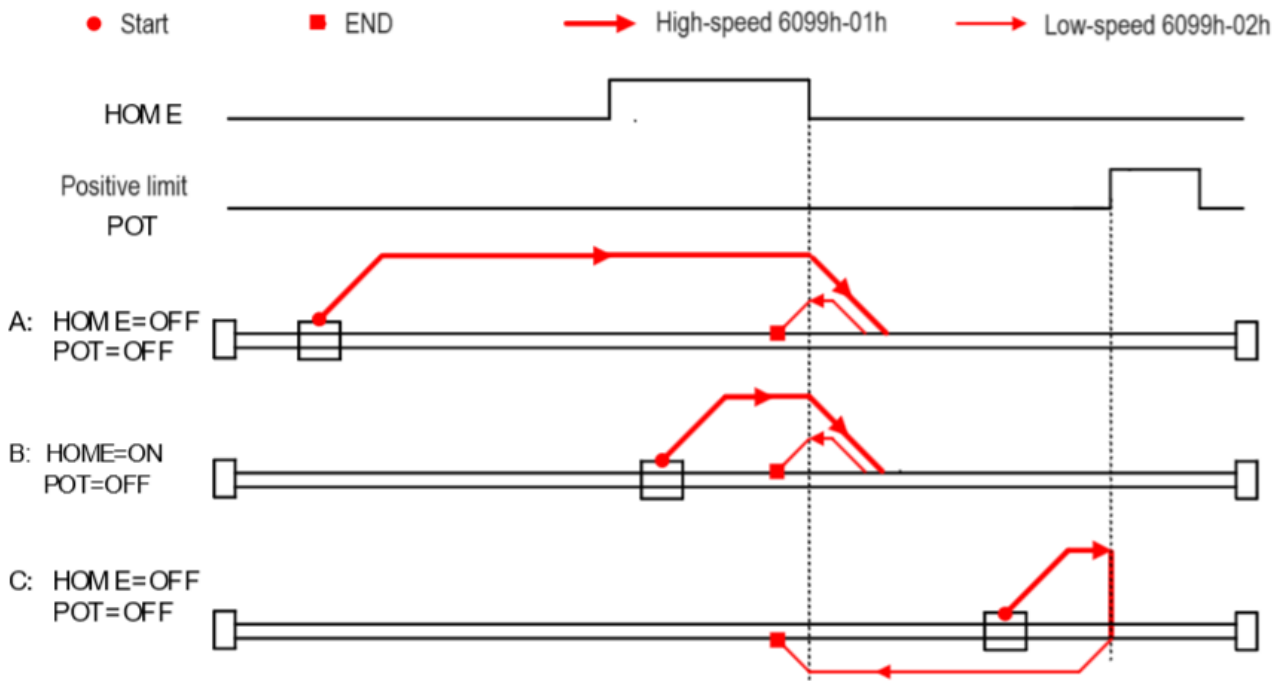


(10) Method 26:

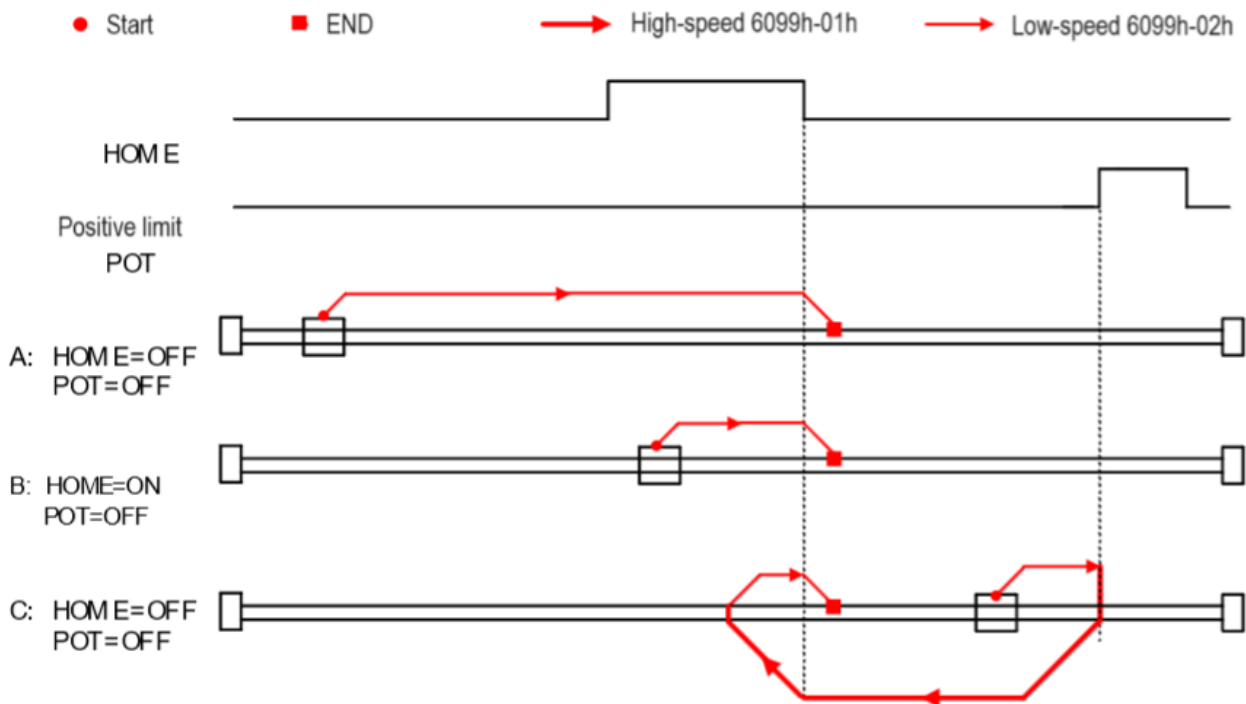


(11) Method 27:

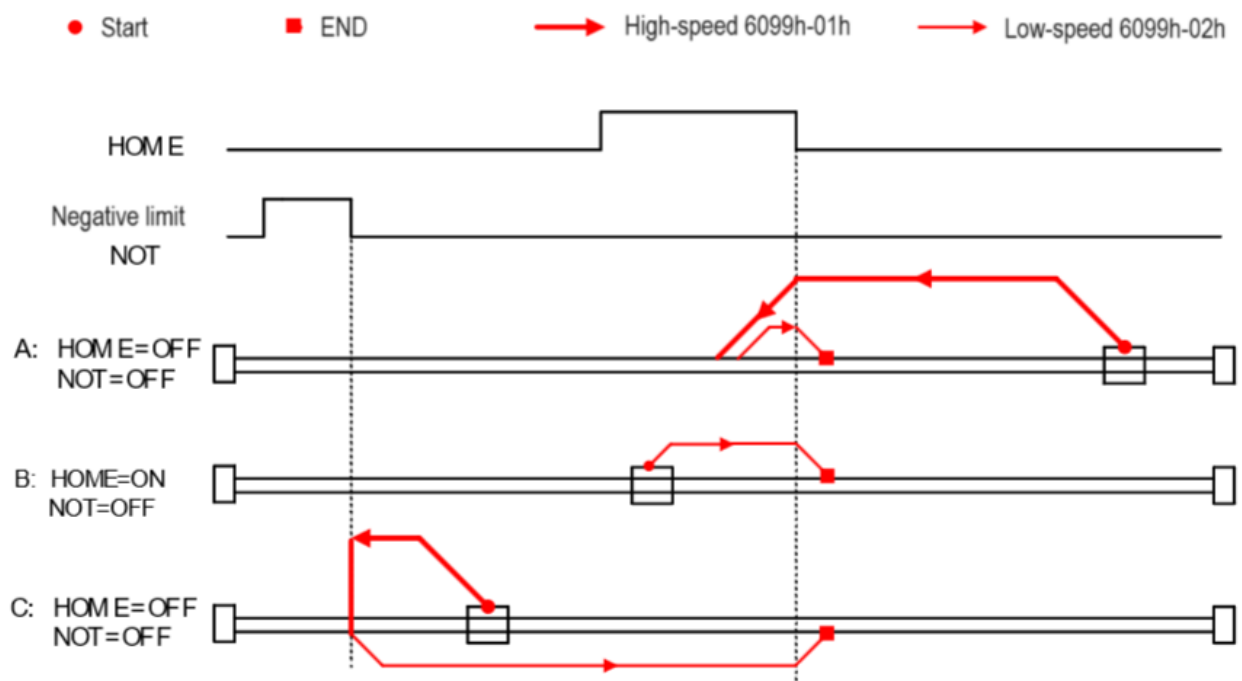


(12) Method 28:

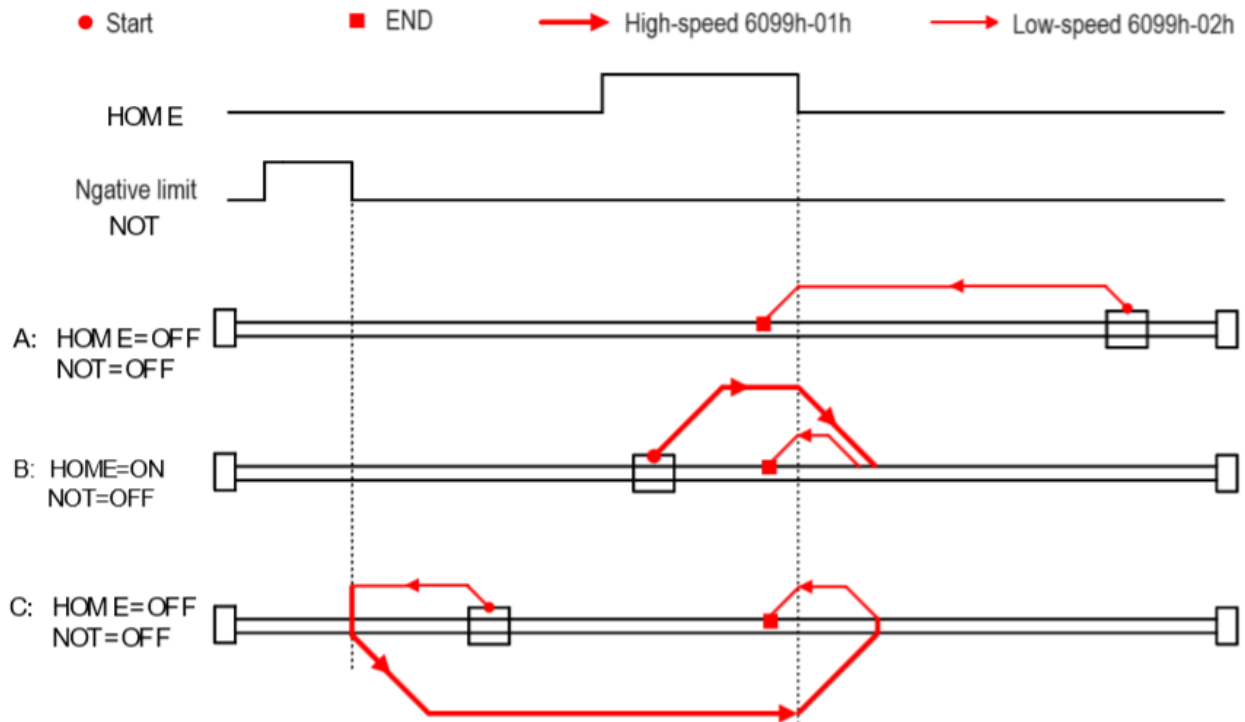


(13) Method 29:

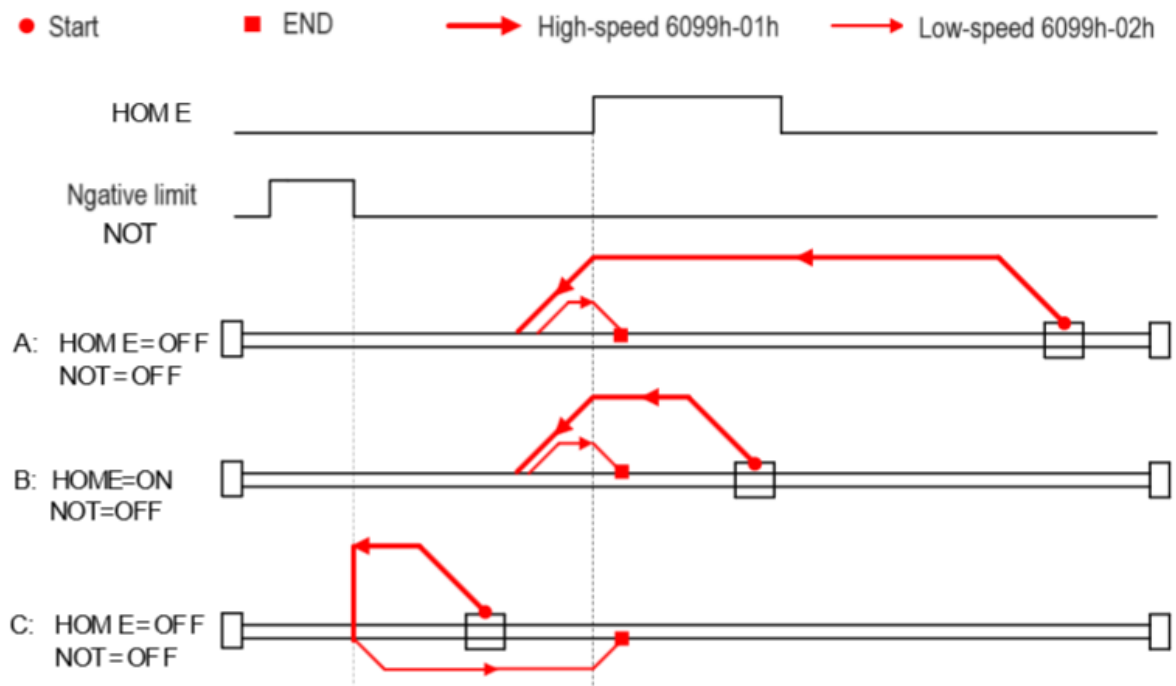

(14) Method 30:

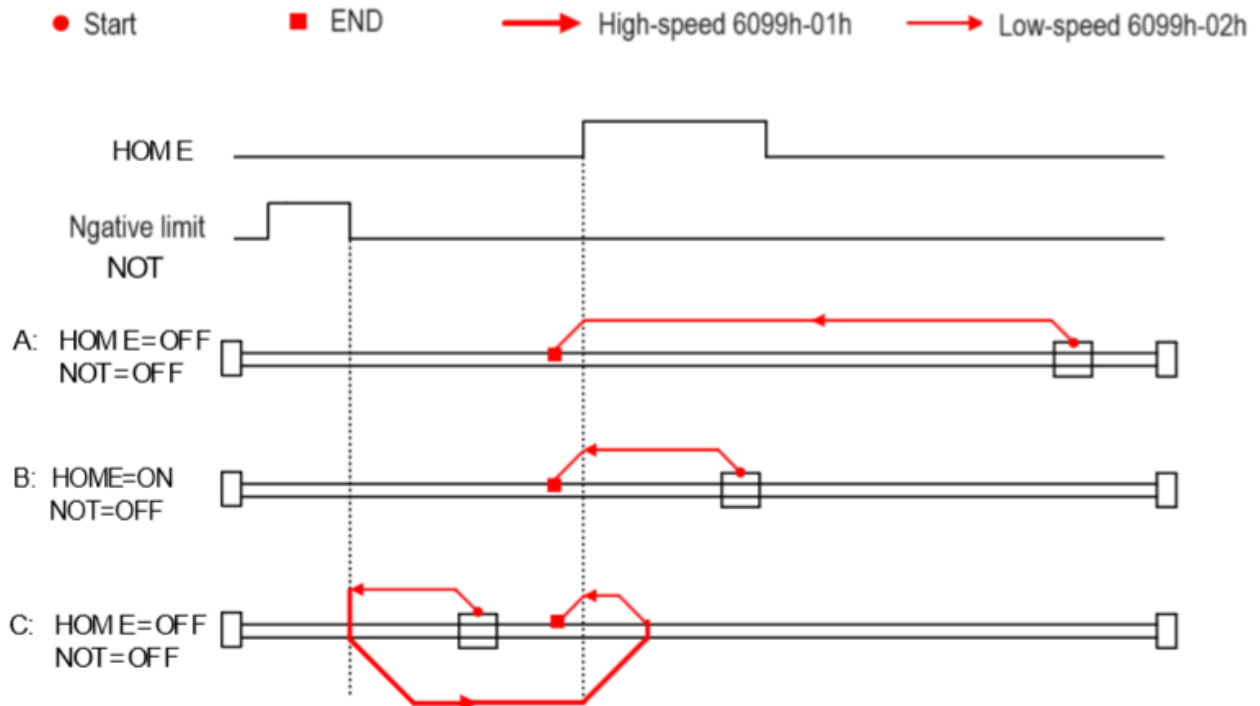

(15) Method 35:

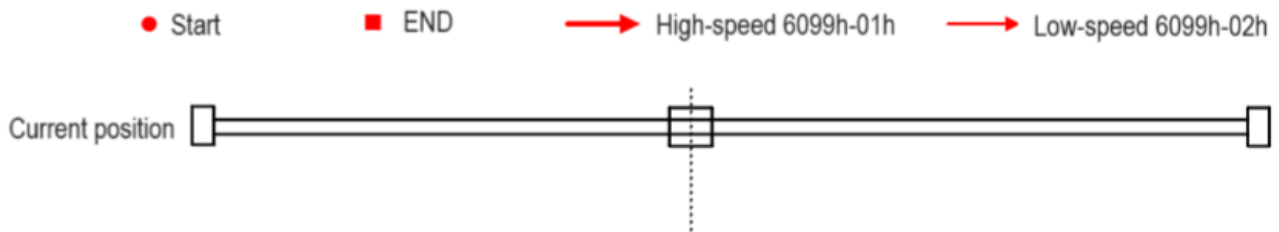

(16) Method 36 & 37:

The homing modes 36 and 37 are torque homing modes, which do not require external limit signals, and rely on detecting the internal torque output of the motor to determine whether the mechanical hard limit has been reached. The relevant homing parameters are as follows:

Index	Name	Flags	Value	Unit
2030:0	Home expansion parameters	RW P	> 6 <	
2030:01	Torque Home MaxTorque output(%)	RW P	0x0032 (50)	
2030:02	Torque Home Detect Limit(%)	RW P	0x0014 (20)	
2030:03	Torque Home speed limit(RPM)	RW P	0x003C (60)	
2030:04	Torque Home Hold Time(50us)	RW P	0x00C8 (200)	
2030:05	Torque Mode speed_Kp	RW P	0x01F4 (500)	
2030:06	Torque Mode speed_Ki	RW P	0x03E8 (1000)	

2030: 01, define the maximum torque output during the torque homing process, which is the percentage of the 0x2000 setting current.

2030: 02, define the torque to determine whether the motor is in the mechanical limit during the torque homing process, which is the percentage of the 0x2000 setting current.


2030: 03, define whether the motor is at the speed limit of the mechanical limit during the torque homing process.

2030: 04, define the holding time of whether the motor is at the mechanical limit during the torque homing process.

2030: 05, define the proportional gain of the speed loop during the torque homing process.


2030: 06, define the integral gain of the speed loop during the torque homing process.

The relevant definitions are as follows:

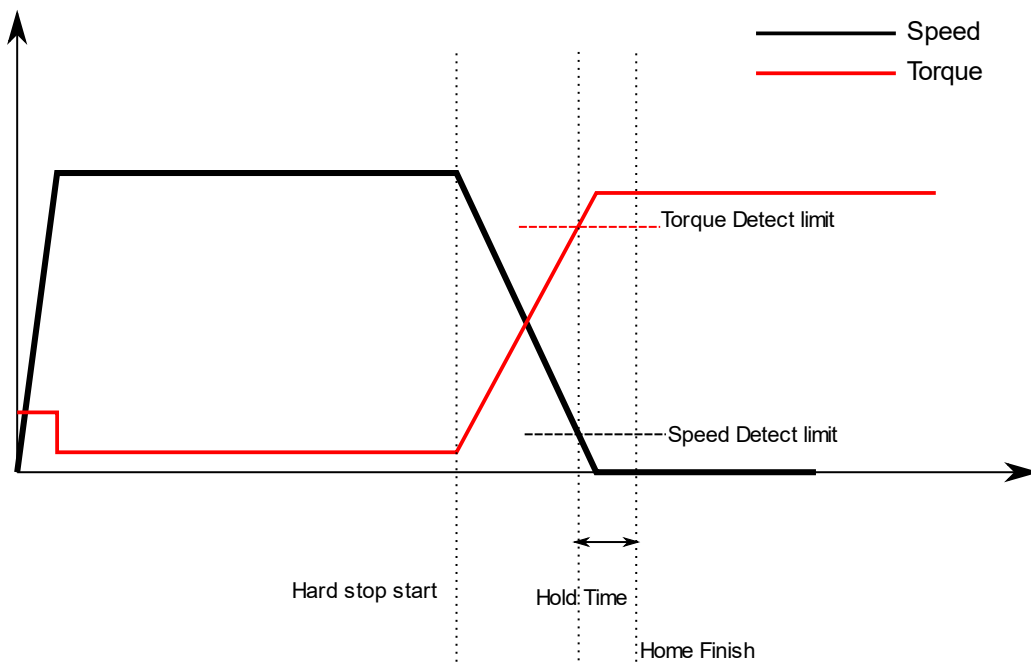

(17) Method 36:

The motor homing at high speed in the direction of CCW, and when it meets the limit stop, the homing is completed.

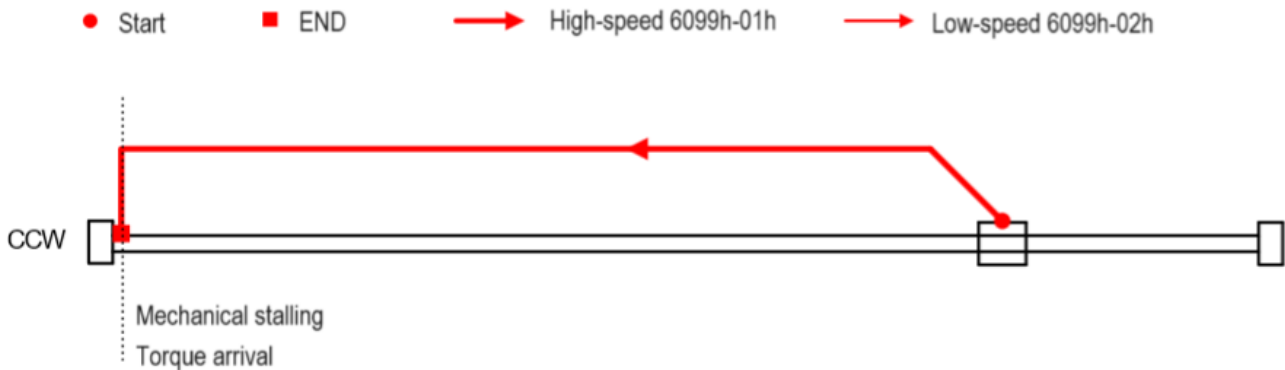

(18) Method 37:

The motor returns to zero at high speed in the direction of CCW, and when it meets the limit stop, the zero return is completed.

